



Three-phase motor for 3 speeds
 with 2 separate windings, winding 1 in Dahlander connection
 for speed 1, 2, winding 2 for star-delta starting

Conn. diagram
KP 0036

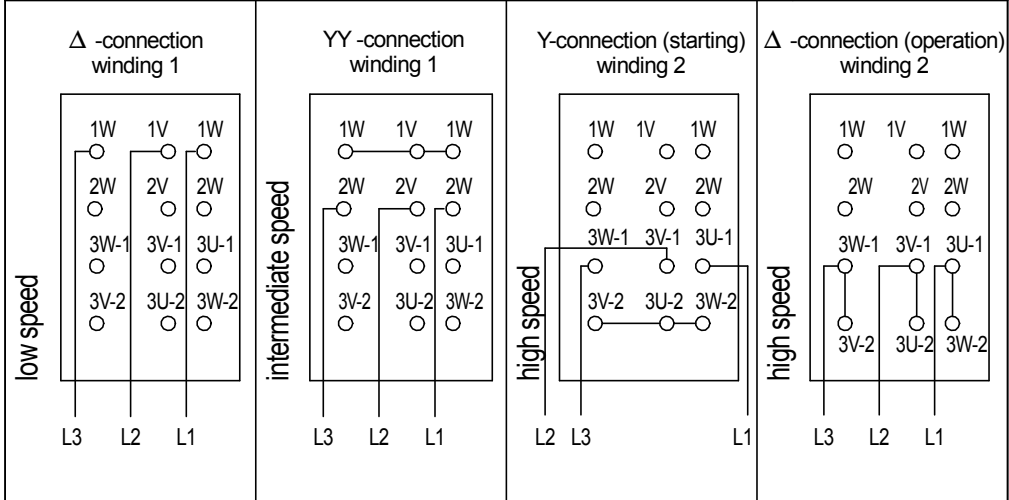

All terminals to the pole-changing switch with built-in star/delta-starting, star connections for intermediate speed by pole-changing switch
 Attention: During operating in low and intermediate speed, the delta of the high speed must be open!!!

			Datum	25.09.2005	
			Bearb	Kresse	
			Gepr		
			Norm		
					
			Elektromotorenwerk Wernigerode		
01			Zeichnungs-Nr. KP 0036 e		
Zust.	Mitteilung	Datum	Name		